

**SECRET**

IDEA-0992  
Copy 7 of 7

4 October 1962

**MEMORANDUM FOR: Deputy Assistant Director, OSA-DD/R**  
**SUBJECT : Maintenance History on Article 378**

1. The following is the maintenance history for Article 378 from 1 January 1962 to date of loss:

a. 26 February 1962

Article completed IRAN at Lockheed. Delivered to Edwards for ferry to Detachment "H".

b. 31 March 1963

Article arrived Detachment "H". Ferry mission write-ups. Rough engine in flight. AC generator inoperative.

CORRECTIVE ACTION: AC generator, voltage regulator, reverse current relay replaced after ferry flight.

c. 1 - 13 April 1962

Four test flights accomplished during this period. All landed with rough engine and flameout during climb through badlands write-ups. Engine change directed by Headquarters. New engine, #610425, corrected flameout and roughness difficulties. Engine #610425 remained in aircraft until it was lost over denied territory. Old engine was returned to LAC for further flight test to determine cause of roughness.

**SECRET**

NOT TO BE DISSEMINATED  
OUTSIDE OSA-DD/R

**SECRET**

IDEA-0992  
Page Two

d. 11 August 1962

Twenty-six flights at Detachment "H" from 13 April to date, all with excellent results and only a few minor write-ups. On Headquarters mission this date, DC generator failed after 274 hours operating time. Wiring harness burned.

CORRECTIVE ACTION: DC generator and harness removed and replaced.

e. 8 September 1962

Seven flights made 11 August to date with two minor write-ups. AC generator failed this date on headquarters mission. Aborted three hours and 38 minutes after take-off. AC generator removed and replaced.

f. 9 September 1962

Aircraft lost over denied territory. Circumstances unknown as of date of this memorandum.

g. Fuel

An analysis of the fuel used on the last flight has been made by sampling the tank used to fuel Article prior to flight. The test of this sample indicated the fuel to be within specifications and suitable for flight.

Total Airframe Time - 964:15

Total Engine Time - 322:10

2. In summary, it appears that this aircraft was maintained in excellent condition at all times by Detachment H. A review of maintenance history and the records of Article 378 do not support a conclusion that a maintenance failure was the primary cause of the loss on 9 September 1962.

  
Chief, Materiel Division  
OSA-DD/R

25X1A


**SECRET**

25X1A

ILLEGIB

Approved For Release 2003/01/24 : CIA-RDP63-00313A000600100036-6

ND/OSA-DD/R  
Dist: Cy 1 - DAD/OSA  
2 - AD/OSA  
3 - ADMIN/OSA  
4 - SB/OSA  
5 - C/OD/OSA  
6 - C/ND/OSA  
7 - RB/OSA

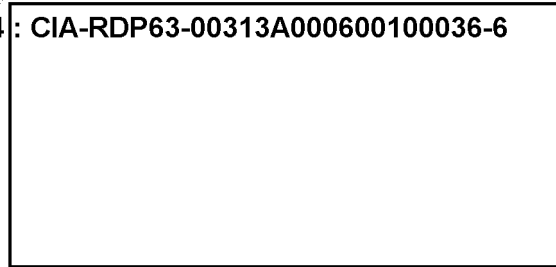

2FCV51